


SD9500



Compressed air meter

SDR32DGXFRKG/US-100

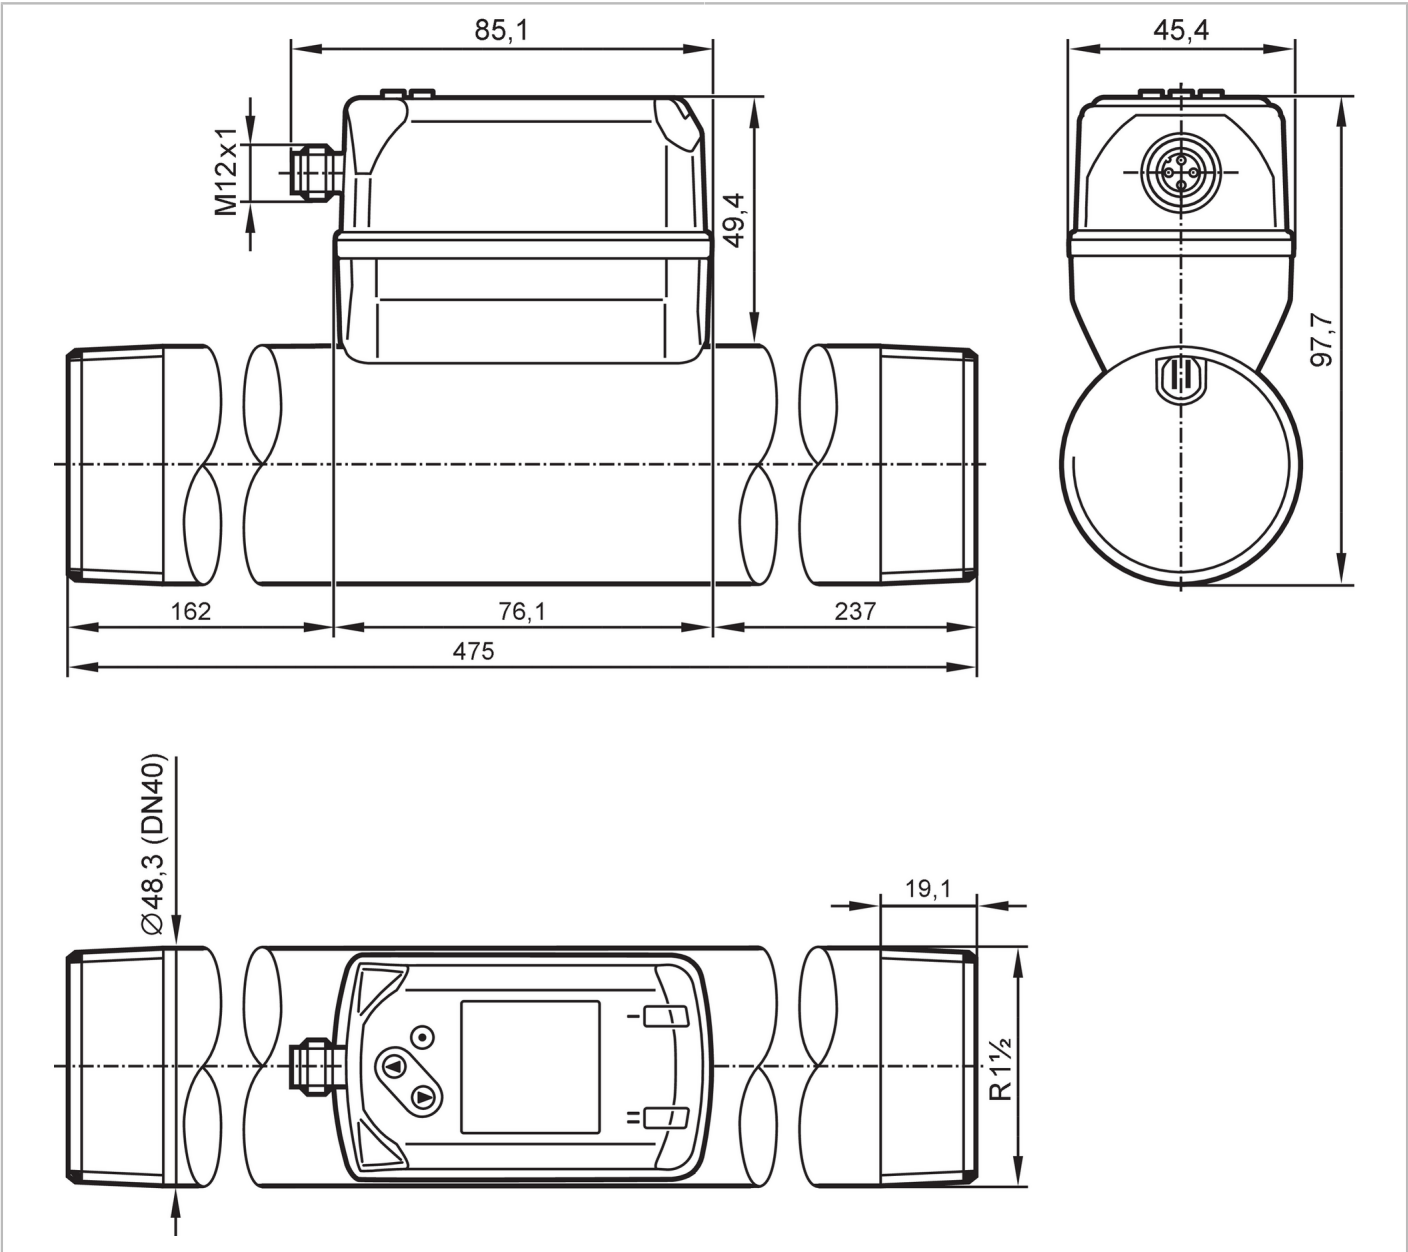

Product characteristics			
Number of inputs and outputs	Number of digital outputs: 2; Number of analog outputs: 1		
Measuring range	20...6830 l/min	0.3...81 m/s	1.4...410 m³/h
Process connection	threaded connection R 1 1/2 external thread DN40		
Application			
Application	for industrial applications		
Media	compressed air		
Medium temperature [°C]	-10...60		
Min. burst pressure	64 bar	6.4 MPa	
Pressure rating	16 bar	1.6 MPa	
MAWP (for applications according to CRN) [bar]	8.9		



Compressed air meter

SDR32DGXFRKG/US-100

Electrical data			
Operating voltage	[V]	18...30 DC; (to SELV/PELV)	
Current consumption	[mA]	< 80	
Protection class		III	
Reverse polarity protection		yes	
Power-on delay time	[s]	1	
Inputs / outputs			
Number of inputs and outputs		Number of digital outputs: 2; Number of analog outputs: 1	
Inputs			
Inputs		counter reset	
Outputs			
Output signal		switching signal; analog signal; pulse signal; IO-Link; (configurable)	
Electrical design		PNP/NPN	
Number of digital outputs		2	
Output function		normally open / closed; (configurable)	
Max. voltage drop switching output DC	[V]	2.5	
Permanent current rating of switching output DC	[mA]	150; (per output)	
Number of analog outputs		1	
Analog current output	[mA]	4...20; (scalable)	
Max. load	[Ω]	500	
Pulse output		consumed quantity meter	
Short-circuit protection		yes	
Type of short-circuit protection		yes (non-latching)	
Overload protection		yes	
Measuring/setting range			
Measuring range		20...6830 l/min	0.3...81 m/s
Display range		0...8200 l/min	0...97.2 m/s
Resolution		10 l/min	0.1 m/s
Set point SP		60...6830 l/min	0.7...81 m/s
Reset point rP		30...6800 l/min	0.3...80.6 m/s
Analog start point ASP		0...5460 l/min	0...64.8 m/s
Analog end point AEP		1370...6830 l/min	16.2...81 m/s
Low flow cut-off LFC		10...70 l/min	0.1...0.9 m/s
In steps of		1 l/min	0.1 m/s
Pressure monitoring			
Measuring range	[bar]	-1...16	
Display range	[bar]	-1...20	
Resolution	[bar]	0.05	
Set point SP	[bar]	-0.92...16	
Reset point rP	[bar]	-1...15.92	
Analog start point	[bar]	-1...12.8	
Analog end point	[bar]	2.2...16	

SD9500



Compressed air meter

SDR32DGXFRKG/US-100

In steps of	[bar]	0.01
Volumetric flow quantity monitoring		
Measuring range	0...100000000 m ³	0...353146667.2 scf
Display range	0...100000000 m ³	0...353146667.2 scf
Set point SP	0.001...10000000 m ³	0.05...353146667.2 scf
Pulse value	0.001...10000000 m ³	0.05...353146667.2 scf
In steps of	0.0001 m ³	0.005 scf
Pulse length	[s]	0.004...2
Temperature monitoring		
Measuring range	-10...60 °C	14...140 °F
Display range	-24...74 °C	-11.2...165.2 °F
Resolution	0.2 °C	0.5 °F
Set point SP	-9.7...60 °C	14.6...140 °F
Reset point rP	-10...59.7 °C	14...139.4 °F
Analog start point	-10...46 °C	14...114.8 °F
Analog end point	4...60 °C	39.2...140 °F
In steps of	0.1 °C	0.1 °F
Accuracy / deviations		
Temperature coefficient	[1/K]	± 0,07 % MW
Accuracy (in the measuring range)		class 141: ± (2 % MW + 0,5 % MEW); class 344: ± (6 % MW + 0,6 % MEW) ; air quality to ISO 8573-1:2010; at medium temperature 23 °C
Repeatability		± (0,4 % MW + 0,1 % MEW)
Pressure monitoring		
Repeatability		± 0,2
	[% of the final value]	
Characteristics deviation		< ± 0,5; (BFSL = Best Fit Straight Line)
	[% of the final value]	
Greatest TEMPCO of the span		± 0,3
	[% MEW / 10 K]	
Greatest TEMPCO of the zero point		± 0,1
	[% MEW / 10 K]	
Temperature monitoring		
Accuracy	[K]	± 0,5; (medium flow in the limit area of the flow measurement range)
Reaction times		
Response time	[s]	< 0.1; (dAP = 0, T09)
Damping process value dAP	[s]	0...5
Pressure monitoring		
Response time	[s]	0.05
Temperature monitoring		
Dynamic response T05 / T09	[s]	T09 = 0,5
Software / programming		
Parameter setting options		hysteresis / window; normally open / closed; current/pulse output; display can be rotated and switched off; Display unit; totalizer

SD9500



Compressed air meter

SDR32DGXFRKG/US-100

Interfaces		
Communication interface	IO-Link	
Transmission type	COM2 (38,4 kBaud)	
IO-Link revision	1.1	
SDCI standard	IEC 61131-9 CDV	
Profiles	Common - I&D	Identification and Diagnosis
	Function	Measurement data, standard resolution
SIO mode	yes	
Required master port class	A	
Process data analog	8	
Process data binary	2	
Min. process cycle time [ms]	7.2	
Supported DeviceIDs	Type of operation	DeviceID
	default	869
Operating conditions		
Ambient temperature [°C]	0...60	
Storage temperature [°C]	-20...85	
Max. relative air humidity [%]	90	
Protection	IP 65; IP 67	
Tests / approvals		
EMC	DIN EN 60947-5-9	
CPA approval	model number	001TG
	accuracy class	-
	maximum allowable error	± 2,5 % FS
	Q (min)	0,05 m³/h
	Q (t)	-
	Q (max)	410 m³/h
Vibration resistance	DIN EN 68000-2-6	
MTTF [years]	183	
UL approval	UL approval number	I012
	File number UL	E174189
Pressure equipment directive	sound engineering practice; can be used for stable gases fluid group 2	
Mechanical data		
Weight [g]	2262	
Housing	rectangular	
Dimensions [mm]	475 x 48.3 x 97.7	
Material	PBT+PC-GF30; PPS GF40; stainless steel (1.4301 / 304); stainless steel (1.4305 / 303); steel (1.5523) galvanized; 2.0401 (brass / CW614N); FKM	
Materials (wetted parts)	stainless steel (1.4301 / 304); stainless steel (1.4305 / 303); FKM; ceramics glass passivated; PPS GF40; Al2O3 (ceramics); acrylate	
Process connection	threaded connection R 1 1/2 external thread DN40	
Displays / operating elements		
Display		Color display 1,44", 128 x 128 pixels
		2 x LED, yellow

SD9500



Compressed air meter

SDR32DGXFRKG/US-100

Remarks	
Remarks	MW = Measured value
	MEW = Final value of the measuring range
	Measuring, display and setting ranges refer to standard volume flow according to DIN ISO 2533.
	For information about installation and operation please see the operating instructions.
Pack quantity	1 pcs.

Electrical connection

Connector: 1 x M12; coding: A; Contacts: 4



Connection	
OUT1/IO-Link:	Switching output flow Switching output temperature Switching output pressure Pulse output quantity meter signal output Preset counter
OUT2/InD:	Switching output flow Switching output temperature Switching output pressure analog output flow analog output temperature analog output pressure signal output Preset counter Pulse output quantity meter Input counter reset